


MSVF3X3315IR-BCPN-MD



Type	AI VARI		Mount	φ 14 Straight Mount
Focal Length	3.3~10.0mm		Back Focus	5.7~12.3mm
Fno.	F1.5		Flange Back	13.8mm
Designed Image Format	1/2.7"(φ 6.75mm)		Exit Pupil	-103.3 ~ -21.5mm
Operation Range	Iris	F1.5-F16-Closed	Filter Size	-
	Focus	0.5m~∞	Aperture	Front φ 15.9mm
	Zoom	3.3~10.0mm		Rear φ 6.6mm
Control	Iris	Mortorized	Dimension	φ 29 x 37.9mm
	Focus	Mortorized		
	Zoom	Mortorized	Weight	24g
	ICR	DC Galvanometer		
Object Size at MOD	Wide	687.3x1090.5mm	687.3x1090.5mm	
	Tele	214.4x289.3mm	214.4x289.3mm	
Field of View	D	123.3° ~ 39.6°	16:9	127.1° ~ 40.5°
	H	4:3 93.7° ~ 31.6°	Screen	107.0° ~ 35.4°
	V	Screen 67.9° ~ 23.7°	Screen	55.9° ~ 19.8°
Control	Iris	Focus	Zoom	IR cut filter
Motor type	PM type stepping motor	PM type stepping motor	PM type stepping motor	Galvanometer
Operation voltage	2.6V ~ 3.8V	2.8V ~ 3.6V	2.8V ~ 3.6V	3.0V ~ 5.0V
Coil resistance	28.5Ω /phase ±10%	28.5Ω /phase ±7%		190Ω /phase ±10%
Excite driving method	2phase Bipolar Constant voltage	1-2phase Bipolar Constant voltage	1-2phase Bipolar Constant voltage	-
Reduction ratio	-	1/131.574	1/131.574	-
Step angle	0.709°	0.171°	0.171°	-
Insulation resistance	1MΩ or more	1MΩ or more	1MΩ or more	1MΩ or more
Light Measuring Method	-			
Input Signal	-			
Iris Accuracy	-			
Sensitivity Adjustment	-			
Operating Temperature	-10 ~ +50 °C			

DIMENSIONS

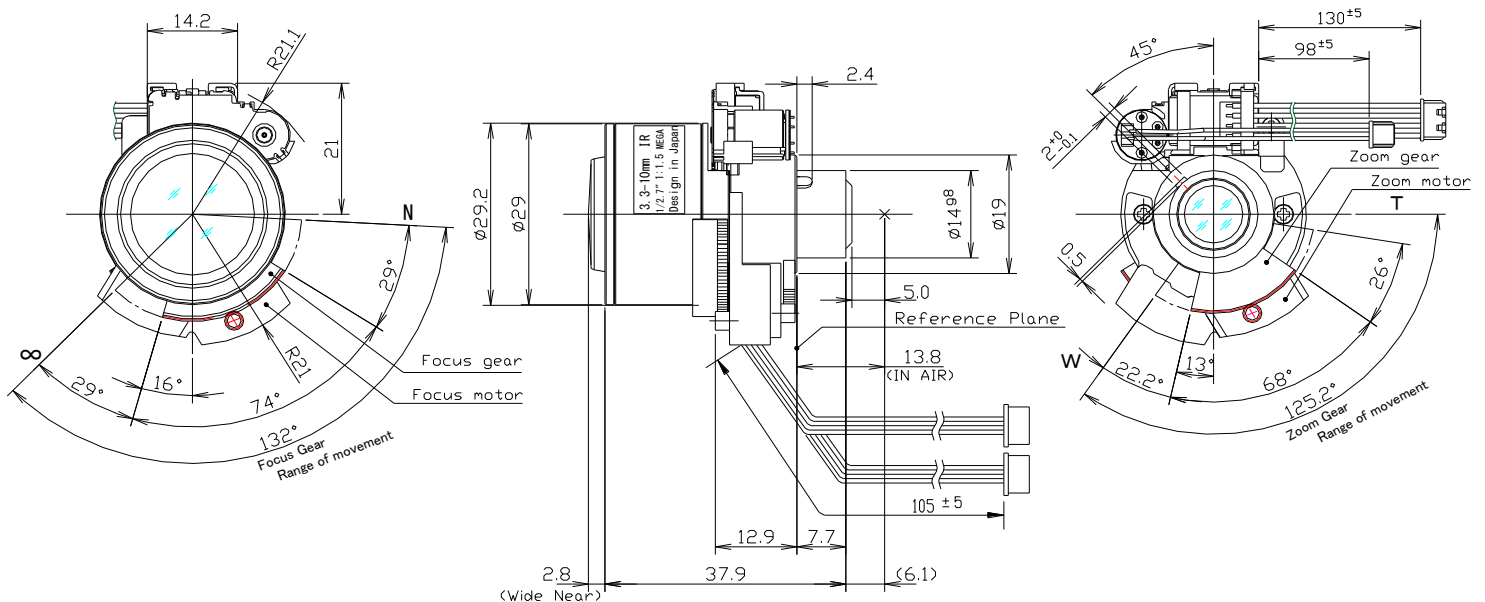


Subject to change without notice

MSVF3X3315IR-BCPN-MD




CONNECTION & CONTROL

(1) Auto Iris terminal

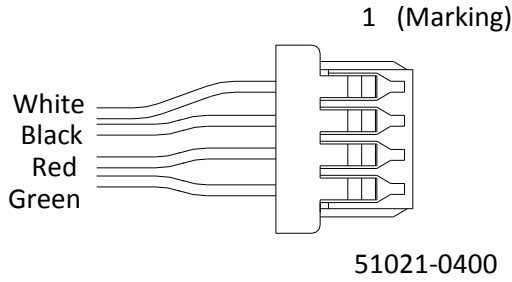


Pin number	Color	Assignment
1	White	A
2	Black	B
3	Red	A
4	Green	B

(2) IR Cut Filter Control terminal

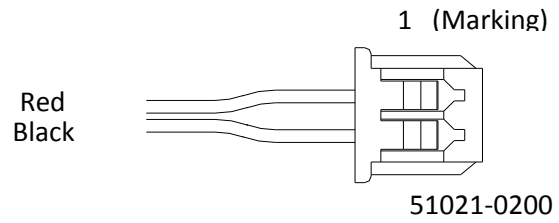


Pin number	Color	Assignment
1	Red	IR IN/OUT(-/+)
2	Black	IR GND

(3) Zoom Moter Control terminal

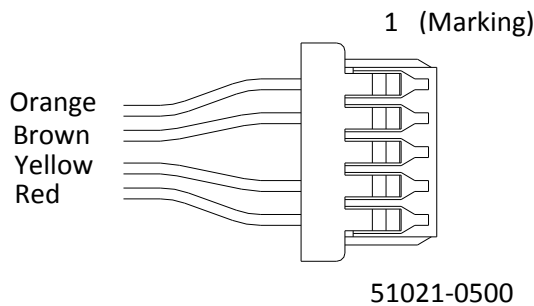


Pin number	Color	Assignment
1	Orange	B
2	Brown	A
3	N/A	N/A
4	Yellow	B
5	Red	A

(4) Focus Moter Control terminal

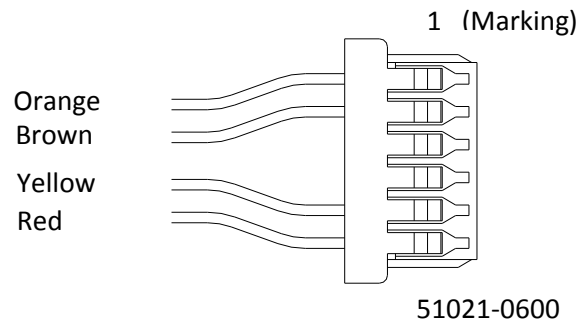

Pin number	Color	Assignment
1	Orange	B
2	Brown	A
3	N/A	N/A
4	N/A	N/A
5	Yellow	B
6	Red	A

(5) Moter Control Excitation pattern

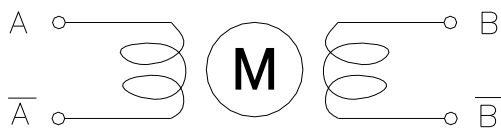

Motor connection

Iris CW: Open → Close

Excite Pottem of CW revolution				
Step	A	Ā	B	B̄
0	H	L	H	L
1	L	H	H	L
2	L	H	L	H
3	H	L	L	H

Focus & Zoom

Excite Pottem of CW revolution				
Step	A	Ā	B	B̄
0	H	L	H	L
1	L	L	H	L
2	L	H	H	L
3	L	H	L	L
4	L	H	L	H
5	L	L	L	H
6	H	L	L	H
7	H	L	L	L